



Model: V85 TT Euro 5

Subject: workshop procedure for resolving irregular idle issue - video tutorial

Dear Dealer / Service Centre,

Please note that the video tutorial titled “V85 TT Euro 5 - IRREGULAR IDLE”, which explains how to identify the aforementioned issue, is now available in the VIDEO BOX section of the Service Portal.

The irregular idle issue is caused by an incorrectly placed connector of the pick-up.

This issue, which does not generate error codes, only occurs with the vehicle stationary and with the engine idling. The attached procedure provides the instructions necessary for resolving this issue.

Please contact the Technical Help Desk of our Technical Support Service for any queries or assistance.



MOTO GUZZI®

PROCEDURE:

Stand on the left hand side of the vehicle
(shift lever side).




Remove the left hand guard of the headstock,
P/N 2B005529.




If the engine pick-up connector is in the incorrect position (as shown in the photo), reposition it correctly.



Move the connector into the correct position and secure it to the connector of the regulator with a cable tie.

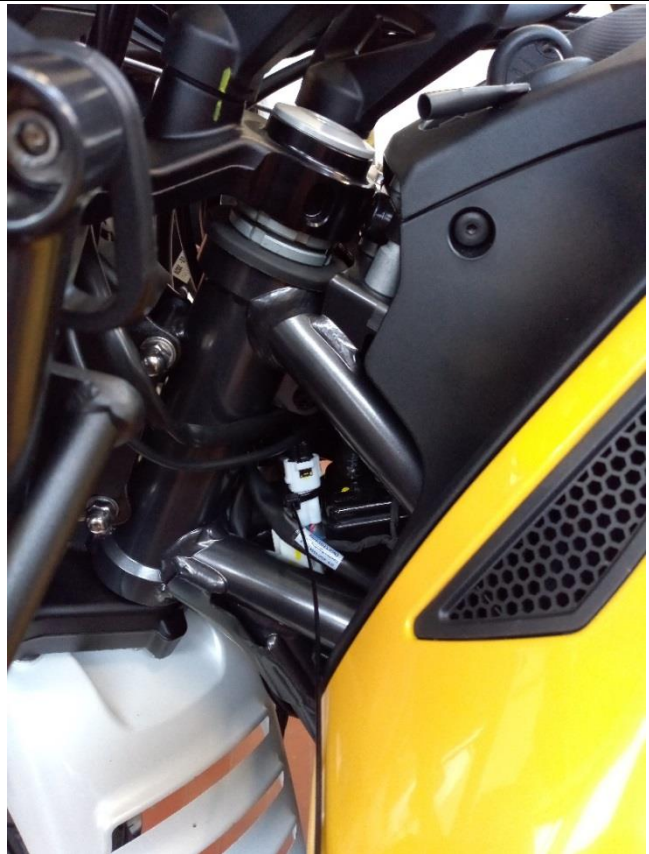

Correct definitive position.

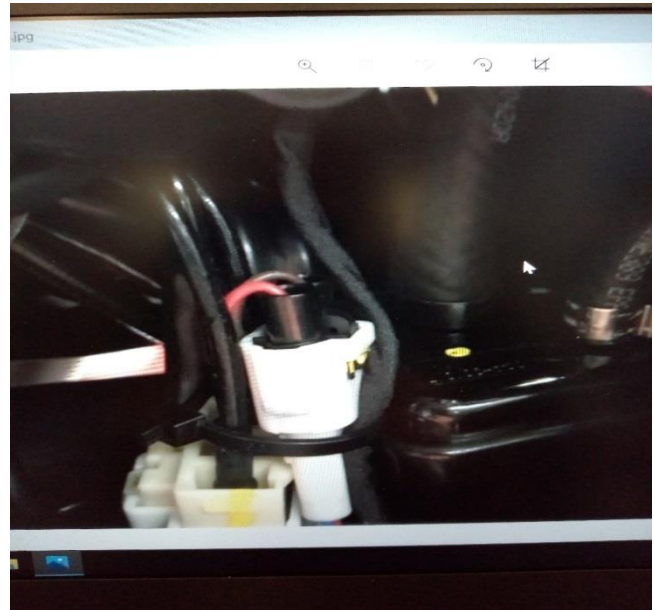

Best regards,

Piaggio & C. SpA

Business Unit Aftersales

Operations & Technical Service